


MAJOR DEFECTS LISTING

Dive Ghat Hadapsar Saswad Highway


NHAIROMH · RI_20260223_Dive Ghat Hadapsar Saswad Highway

<p>TOTAL MAJOR DEFECTS</p> <p>398</p> <p>24.9% of all detections</p>	<p>CATEGORIES TRIGGERED</p> <p>3</p> <p>Block Crack, Pothole, Popout</p>	<p>KM RANGE AFFECTED</p> <p>220 – 233 (14 km)</p>	<p>SEVERITY FILTER</p> <p>NHAIROMH-specific</p> <p>Block Crack · Pothole · Pothole (large) · Pothole (medium) · Pothole (small) · Popout</p>
---	---	--	---

Major defects by category

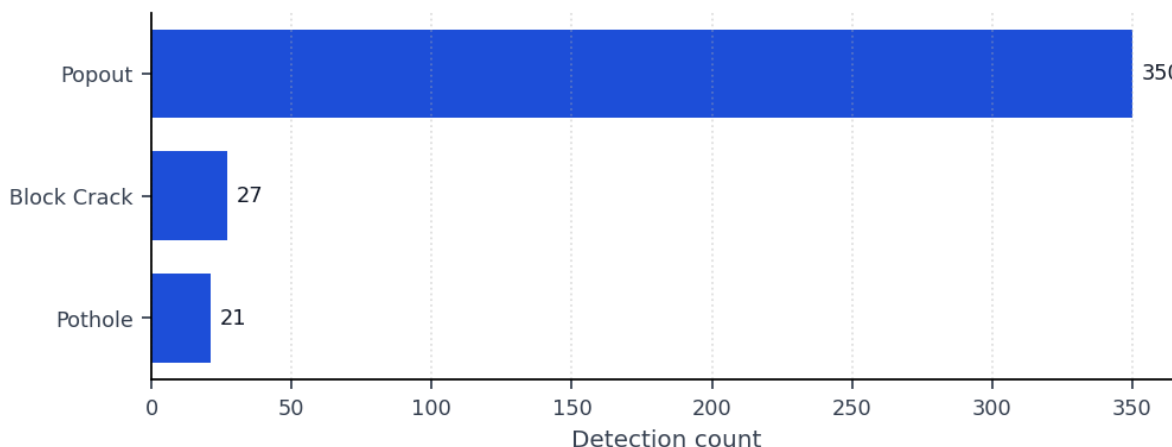

Major defects by kilometer

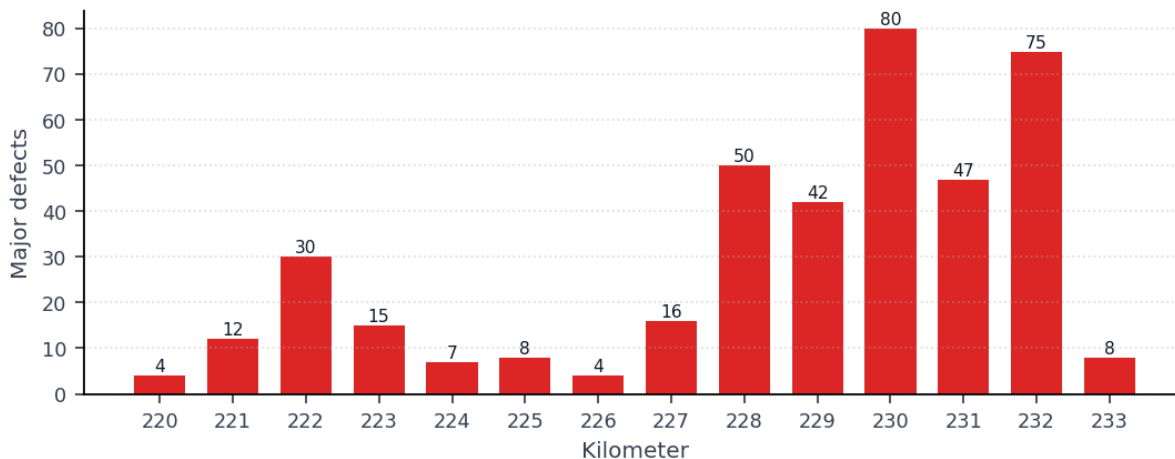

Km-wise summary table

Per-km defect count split by side and category. Empty cells show as —.

Km	LHS						RHS						Total
	BLKCK	POTHL	POTHLL	POTHLM	POTHLS	PPOUT	BLKCK	POTHL	POTHLL	POTHLM	POTHLS	PPOUT	
220	—	—	—	—	—	1	1	1	—	—	—	1	4
221	1	—	—	—	—	6	2	—	—	—	—	3	12
222	1	1	—	—	—	22	—	—	—	—	—	6	30
223	—	—	—	—	—	6	1	1	—	—	—	7	15
224	—	—	—	—	—	4	2	—	—	—	—	1	7
225	1	—	—	—	—	5	—	—	—	—	—	2	8
226	—	—	—	—	—	4	—	—	—	—	—	—	4
227	1	—	—	—	—	10	1	—	—	—	—	4	16
228	1	—	—	—	—	41	2	—	—	—	—	6	50
229	1	1	—	—	—	28	1	3	—	—	—	8	42
230	—	—	—	—	—	63	3	2	—	—	—	12	80
231	2	—	—	—	—	34	3	3	—	—	—	5	47
232	2	2	—	—	—	67	—	3	—	—	—	1	75
233	—	2	—	—	—	1	1	2	—	—	—	2	8
Total	10	6	—	—	—	292	17	15	—	—	—	58	398

Legend: **BLKCK** Block Crack · **POTHL** Pothole · **POTHLL** Pothole (large) · **POTHLM** Pothole (medium) · **POTHLS** Pothole (small) · **PPOUT** Popout

Kilometer 220





4 major defects · LHS 1 · RHS 3

2 Popout · 1 Block Crack · 1 Pothole



Scan to open the km 220 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=220

#	Image	Defect	Side	Chainage span
1		Popout	LHS	220.941
2		Pothole	RHS	220.900
3		Popout	RHS	220.900
4		Block Crack	RHS	220.934

Kilometer 221


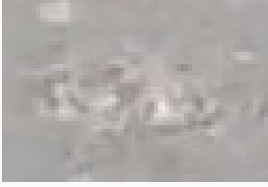






12 major defects · LHS 7 · RHS 5





9 Popout · 3 Block Crack



Scan to open the km 221 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=221

#	Image	Defect	Side	Chainage span
1		Popout	LHS	221.000
2		Popout	LHS	221.032
3		Popout	LHS	221.263
4		Block Crack	LHS	221.416 → 221.418
5		Popout	LHS	221.465
6		Popout	LHS	221.530 → 221.531
7		Popout	LHS	221.859
8		Block Crack	RHS	221.037 → 221.046

#	Image	Defect	Side	Chainage span
9		Block Crack	RHS	221.417
10		Popout	RHS	221.658
11		Popout	RHS	221.721
12		Popout	RHS	221.948 → 221.950

Kilometer 222








30 major defects · LHS 24 · RHS 6









28 Popout · 1 Block Crack · 1 Pothole





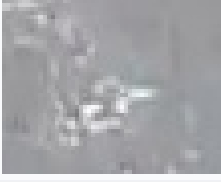

Scan to open the km 222 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=222

#	Image	Defect	Side	Chainage span
1		Popout	LHS	222.092
2		Popout	LHS	222.140
3		Popout	LHS	222.259
4		Popout	LHS	222.265
5		Popout	LHS	222.273
6		Popout	LHS	222.291
7		Popout	LHS	222.319

#	Image	Defect	Side	Chainage span
8		Popout	LHS	222.687
9		Popout	LHS	222.690
10		Popout	LHS	222.694
11		Popout	LHS	222.704
12		Popout	LHS	222.706
13		Popout	LHS	222.715
14		Popout	LHS	222.718
15		Popout	LHS	222.768 → 222.769
16		Popout	LHS	222.785

#	Image	Defect	Side	Chainage span
17		Popout	LHS	222.801
18		Popout	LHS	222.848
19		Popout	LHS	222.867
20		Popout	LHS	222.876
21		Pothole	LHS	222.921 → 222.922
22		Popout	LHS	222.924
23		Popout	LHS	222.929
24		Block Crack	LHS	222.938
25		Popout	RHS	222.162
26		Popout	RHS	222.259

#	Image	Defect	Side	Chainage span
27		Popout	RHS	222.496
28		Popout	RHS	222.571
29		Popout	RHS	222.660
30		Popout	RHS	222.939

Kilometer 223

15 major defects · LHS 6 · RHS 9








13 Popout · 1 Block Crack · 1 Pothole



Scan to open the km 223 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=223

#	Image	Defect	Side	Chainage span
1		Popout	LHS	223.026
2		Popout	LHS	223.033
3		Popout	LHS	223.061
4		Popout	LHS	223.236
5		Popout	LHS	223.270
6		Popout	LHS	223.841 → 223.842
7		Popout	RHS	223.027
8		Popout	RHS	223.203

#	Image	Defect	Side	Chainage span
9		Popout	RHS	223.205
10		Popout	RHS	223.215
11		Block Crack	RHS	223.229 → 223.234
12		Pothole	RHS	223.229
13		Popout	RHS	223.642
14		Popout	RHS	223.674
15		Popout	RHS	223.908

Kilometer 224








7 major defects · LHS 4 · RHS 3

5 Popout · 2 Block Crack

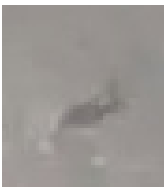

Scan to open the km 224 inspection videos:

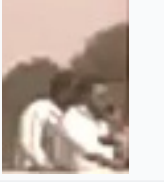https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=224

#	Image	Defect	Side	Chainage span
1		Popout	LHS	224.011
2		Popout	LHS	224.152
3		Popout	LHS	224.291
4		Popout	LHS	224.984
5		Block Crack	RHS	224.073
6		Block Crack	RHS	224.137 → 224.138
7		Popout	RHS	224.166 → 224.167

Kilometer 225









8 major defects · LHS 6 · RHS 2

7 Popout · 1 Block Crack

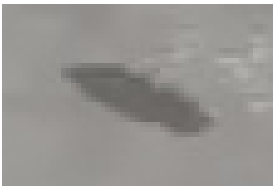

Scan to open the km 225 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=225

#	Image	Defect	Side	Chainage span
1		Popout	LHS	225.414 → 225.415
2		Block Crack	LHS	225.661
3		Popout	LHS	225.736
4		Popout	LHS	225.870
5		Popout	LHS	225.915
6		Popout	LHS	225.965
7		Popout	RHS	225.700
8		Popout	RHS	225.712 → 225.713

Kilometer 226

4 major defects · LHS 4 · RHS 0

4 Popout



Scan to open the km 226 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=226

#	Image	Defect	Side	Chainage span
1		Popout	LHS	226.069 → 226.070
2		Popout	LHS	226.153
3		Popout	LHS	226.202
4		Popout	LHS	226.210

Kilometer 227









16 major defects · LHS 11 · RHS 5

14 Popout · 2 Block Crack



Scan to open the km 227 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=227

#	Image	Defect	Side	Chainage span
1		Popout	LHS	227.448
2		Popout	LHS	227.457
3		Block Crack	LHS	227.535
4		Popout	LHS	227.606 → 227.607
5		Popout	LHS	227.609
6		Popout	LHS	227.636
7		Popout	LHS	227.661
8		Popout	LHS	227.682

#	Image	Defect	Side	Chainage span
9		Popout	LHS	227.719 → 227.720
10		Popout	LHS	227.728
11		Popout	LHS	227.935
12		Popout	RHS	227.208
13		Popout	RHS	227.311 → 227.312
14		Block Crack	RHS	227.312 → 227.314
15		Popout	RHS	227.583
16		Popout	RHS	227.696

Kilometer 228


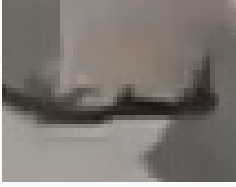






50 major defects · LHS 42 · RHS 8

47 Popout · 3 Block Crack







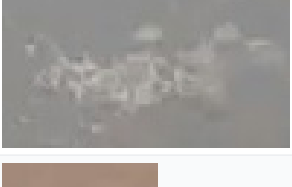





Scan to open the km 228 inspection videos:








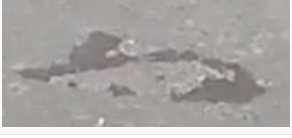



https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=228



#	Image	Defect	Side	Chainage span
1		Popout	LHS	228.036
2		Popout	LHS	228.101
3		Block Crack	LHS	228.118
4		Popout	LHS	228.194
5		Popout	LHS	228.208
6		Popout	LHS	228.248
7		Popout	LHS	228.255
8		Popout	LHS	228.444

#	Image	Defect	Side	Chainage span
9		Popout	LHS	228.450 → 228.451
10		Popout	LHS	228.453 → 228.455
11		Popout	LHS	228.461 → 228.463
12		Popout	LHS	228.482
13		Popout	LHS	228.491
14		Popout	LHS	228.501
15		Popout	LHS	228.507
16		Popout	LHS	228.523
17		Popout	LHS	228.586 → 228.588
18		Popout	LHS	228.607

#	Image	Defect	Side	Chainage span
19		Popout	LHS	228.611
20		Popout	LHS	228.638
21		Popout	LHS	228.641 → 228.642
22		Popout	LHS	228.645
23		Popout	LHS	228.662 → 228.663
24		Popout	LHS	228.716
25		Popout	LHS	228.743 → 228.745
26		Popout	LHS	228.750
27		Popout	LHS	228.760

#	Image	Defect	Side	Chainage span
28		Popout	LHS	228.781 → 228.782
29		Popout	LHS	228.792 → 228.793
30		Popout	LHS	228.832 → 228.833
31		Popout	LHS	228.855 → 228.856
32		Popout	LHS	228.886
33		Popout	LHS	228.921
34		Popout	LHS	228.925
35		Popout	LHS	228.930 → 228.931
36		Popout	LHS	228.936 → 228.937
37		Popout	LHS	228.943 → 228.944

#	Image	Defect	Side	Chainage span
38		Popout	LHS	228.946
39		Popout	LHS	228.965
40		Popout	LHS	228.981
41		Popout	LHS	228.986
42		Popout	LHS	228.998
43		Popout	RHS	228.037 → 228.039
44		Popout	RHS	228.056
45		Popout	RHS	228.139
46		Popout	RHS	228.640
47		Popout	RHS	228.664
48		Popout	RHS	228.753 → 228.754

#	Image	Defect	Side	Chainage span
49		Block Crack	RHS	228.909
50		Block Crack	RHS	228.918

Kilometer 229






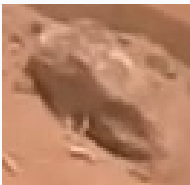

42 major defects · LHS 30 · RHS 12










36 Popout · 4 Pothole · 2 Block Crack




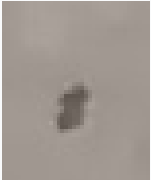





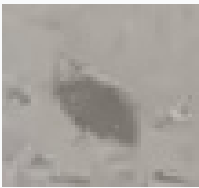


Scan to open the km 229 inspection videos:






https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=229

#	Image	Defect	Side	Chainage span
1		Popout	LHS	229.011 → 229.012
2		Popout	LHS	229.018 → 229.020
3		Popout	LHS	229.028
4		Popout	LHS	229.033 → 229.035
5		Popout	LHS	229.060 → 229.061
6		Popout	LHS	229.107
7		Popout	LHS	229.121

#	Image	Defect	Side	Chainage span
8		Popout	LHS	229.143 → 229.145
9		Popout	LHS	229.185
10		Popout	LHS	229.192
11		Popout	LHS	229.196
12		Popout	LHS	229.228
13		Popout	LHS	229.343 → 229.344
14		Popout	LHS	229.444
15		Popout	LHS	229.456
16		Popout	LHS	229.480 → 229.481

#	Image	Defect	Side	Chainage span
17		Popout	LHS	229.502
18		Popout	LHS	229.505
19		Popout	LHS	229.509
20		Popout	LHS	229.585
21		Popout	LHS	229.620
22		Popout	LHS	229.685
23		Block Crack	LHS	229.733
24		Popout	LHS	229.793
25		Popout	LHS	229.825
26		Popout	LHS	229.853

#	Image	Defect	Side	Chainage span
27		Popout	LHS	229.857
28		Pothole	LHS	229.898 → 229.900
29		Popout	LHS	229.950 → 229.951
30		Popout	LHS	229.984 → 229.985
31		Popout	RHS	229.084
32		Popout	RHS	229.196
33		Popout	RHS	229.204
34		Popout	RHS	229.314 → 229.315
35		Popout	RHS	229.582
36		Block Crack	RHS	229.786
37		Pothole	RHS	229.854 → 229.857

#	Image	Defect	Side	Chainage span
38		Popout	RHS	229.882
39		Pothole	RHS	229.896 → 229.897
40		Popout	RHS	229.897
41		Pothole	RHS	229.901 → 229.902
42		Popout	RHS	229.962

Kilometer 230




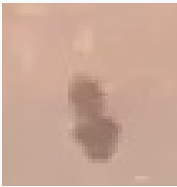
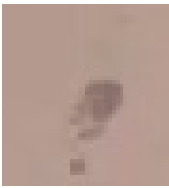
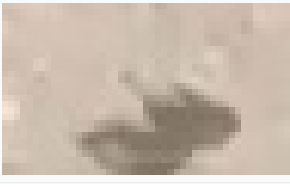

80 major defects · LHS 63 · RHS 17










75 Popout · 3 Block Crack · 2 Pothole


















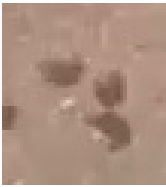


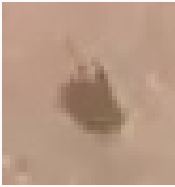Scan to open the km 230 inspection videos:



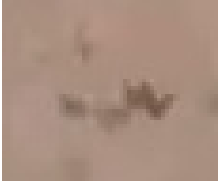
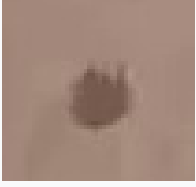

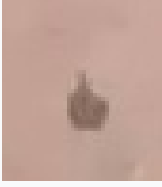
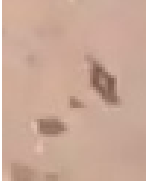


https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=230


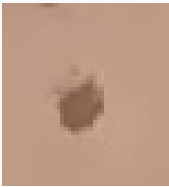
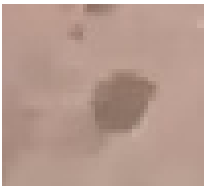


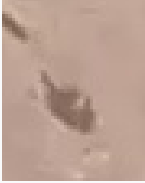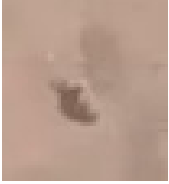
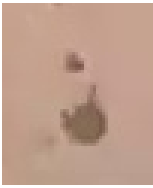
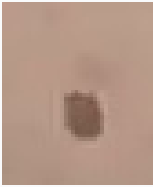

#	Image	Defect	Side	Chainage span
1		Popout	LHS	230.061
2		Popout	LHS	230.141 → 230.143
3		Popout	LHS	230.145
4		Popout	LHS	230.186
5		Popout	LHS	230.198
6		Popout	LHS	230.256
7		Popout	LHS	230.270



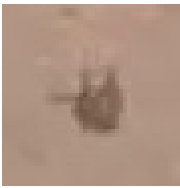






#	Image	Defect	Side	Chainage span
8		Popout	LHS	230.275
9		Popout	LHS	230.278
10		Popout	LHS	230.286 → 230.287
11		Popout	LHS	230.290
12		Popout	LHS	230.292 → 230.294
13		Popout	LHS	230.306
14		Popout	LHS	230.316
15		Popout	LHS	230.319
16		Popout	LHS	230.323 → 230.325












#	Image	Defect	Side	Chainage span
17		Popout	LHS	230.330
18		Popout	LHS	230.333
19		Popout	LHS	230.340
20		Popout	LHS	230.344 → 230.345
21		Popout	LHS	230.369
22		Popout	LHS	230.371
23		Popout	LHS	230.376 → 230.378
24		Popout	LHS	230.383
25		Popout	LHS	230.385









#	Image	Defect	Side	Chainage span
26		Popout	LHS	230.387 → 230.389
27		Popout	LHS	230.395
28		Popout	LHS	230.425
29		Popout	LHS	230.437
30		Popout	LHS	230.440
31		Popout	LHS	230.451 → 230.452
32		Popout	LHS	230.457 → 230.458
33		Popout	LHS	230.469 → 230.471
34		Popout	LHS	230.476 → 230.477

#	Image	Defect	Side	Chainage span
35		Popout	LHS	230.479
36		Popout	LHS	230.481
37		Popout	LHS	230.522 → 230.523
38		Popout	LHS	230.528
39		Popout	LHS	230.533
40		Popout	LHS	230.543 → 230.544
41		Popout	LHS	230.549 → 230.552
42		Popout	LHS	230.558
43		Popout	LHS	230.567

#	Image	Defect	Side	Chainage span
44		Popout	LHS	230.613
45		Popout	LHS	230.616
46		Popout	LHS	230.631
47		Popout	LHS	230.634 → 230.635
48		Popout	LHS	230.638
49		Popout	LHS	230.666
50		Popout	LHS	230.673
51		Popout	LHS	230.683
52		Popout	LHS	230.690

#	Image	Defect	Side	Chainage span
53		Popout	LHS	230.698
54		Popout	LHS	230.758 → 230.759
55		Popout	LHS	230.761
56		Popout	LHS	230.846 → 230.847
57		Popout	LHS	230.849 → 230.850
58		Popout	LHS	230.860 → 230.861
59		Popout	LHS	230.867
60		Popout	LHS	230.912
61		Popout	LHS	230.930

#	Image	Defect	Side	Chainage span
62		Popout	LHS	230.943
63		Popout	LHS	230.995
64		Popout	RHS	230.254
65		Block Crack	RHS	230.268 → 230.271
66		Block Crack	RHS	230.413 → 230.414
67		Popout	RHS	230.447 → 230.448
68		Popout	RHS	230.466
69		Pothole	RHS	230.527 → 230.528
70		Popout	RHS	230.528
71		Popout	RHS	230.535 → 230.536
72		Popout	RHS	230.571

#	Image	Defect	Side	Chainage span
73		Block Crack	RHS	230.664
74		Popout	RHS	230.674
75		Popout	RHS	230.691
76		Popout	RHS	230.693 → 230.694
77		Popout	RHS	230.726
78		Pothole	RHS	230.767
79		Popout	RHS	230.787
80		Popout	RHS	230.958

Kilometer 231

47 major defects · LHS 36 · RHS 11




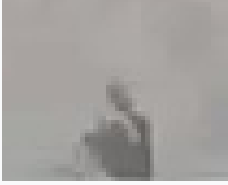

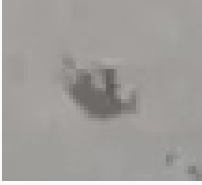



39 Popout · 5 Block Crack · 3 Pothole

















Scan to open the km 231 inspection videos:












https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=231



#	Image	Defect	Side	Chainage span
1		Popout	LHS	231.000
2		Popout	LHS	231.002
3		Popout	LHS	231.004
4		Popout	LHS	231.111 → 231.112
5		Popout	LHS	231.324 → 231.325
6		Popout	LHS	231.344
7		Popout	LHS	231.370

#	Image	Defect	Side	Chainage span
8		Popout	LHS	231.420
9		Popout	LHS	231.435
10		Popout	LHS	231.443
11		Popout	LHS	231.445 → 231.447
12		Popout	LHS	231.449
13		Popout	LHS	231.455 → 231.456
14		Popout	LHS	231.466 → 231.467
15		Popout	LHS	231.503
16		Popout	LHS	231.704

#	Image	Defect	Side	Chainage span
17		Popout	LHS	231.746
18		Block Crack	LHS	231.767
19		Popout	LHS	231.771
20		Popout	LHS	231.784
21		Popout	LHS	231.786
22		Popout	LHS	231.813
23		Popout	LHS	231.815
24		Popout	LHS	231.817
25		Popout	LHS	231.823

#	Image	Defect	Side	Chainage span
26		Popout	LHS	231.827
27		Popout	LHS	231.856 → 231.858
28		Popout	LHS	231.864 → 231.866
29		Popout	LHS	231.874
30		Popout	LHS	231.878
31		Popout	LHS	231.881
32		Popout	LHS	231.892
33		Popout	LHS	231.903
34		Block Crack	LHS	231.981

#	Image	Defect	Side	Chainage span
35		Popout	LHS	231.981
36		Popout	LHS	231.983
37		Popout	RHS	231.042
38		Block Crack	RHS	231.290 → 231.291
39		Popout	RHS	231.408
40		Pothole	RHS	231.446 → 231.447
41		Popout	RHS	231.535 → 231.536
42		Pothole	RHS	231.575
43		Block Crack	RHS	231.609
44		Pothole	RHS	231.668 → 231.669
45		Popout	RHS	231.672 → 231.673

#	Image	Defect	Side	Chainage span
46		Block Crack	RHS	231.715 → 231.725
47		Popout	RHS	231.888

Kilometer 232



75 major defects · LHS 71 · RHS 4










68 Popout · 5 Pothole · 2 Block Crack















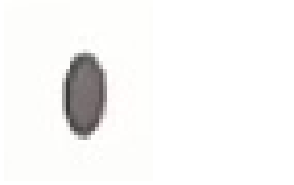



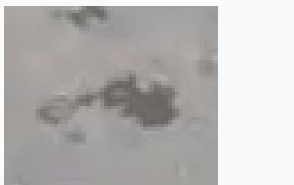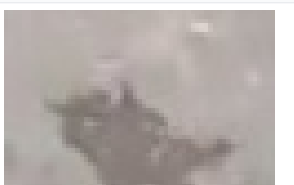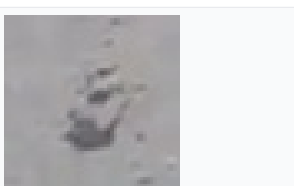


Scan to open the km 232 inspection videos:


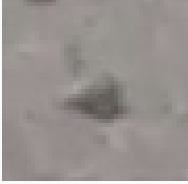







https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=232

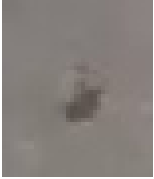





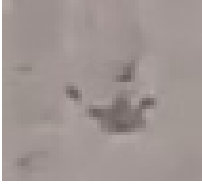


#	Image	Defect	Side	Chainage span
1		Block Crack	LHS	232.010 → 232.017
2		Popout	LHS	232.024
3		Popout	LHS	232.065 → 232.066
4		Popout	LHS	232.069
5		Popout	LHS	232.071 → 232.073
6		Popout	LHS	232.084 → 232.085
7		Popout	LHS	232.091 → 232.092










#	Image	Defect	Side	Chainage span
8		Popout	LHS	232.095
9		Popout	LHS	232.099 → 232.100
10		Popout	LHS	232.103
11		Popout	LHS	232.106
12		Popout	LHS	232.121 → 232.122
13		Popout	LHS	232.159
14		Popout	LHS	232.190
15		Popout	LHS	232.212
16		Popout	LHS	232.220 → 232.221













#	Image	Defect	Side	Chainage span
17		Popout	LHS	232.223
18		Popout	LHS	232.245
19		Popout	LHS	232.274
20		Popout	LHS	232.312
21		Popout	LHS	232.314 → 232.315
22		Popout	LHS	232.317 → 232.319
23		Popout	LHS	232.321
24		Popout	LHS	232.326 → 232.327
25		Pothole	LHS	232.327
26		Popout	LHS	232.329 → 232.331


#	Image	Defect	Side	Chainage span
27		Popout	LHS	232.333
28		Popout	LHS	232.335 → 232.338
29		Popout	LHS	232.340 → 232.345
30		Popout	LHS	232.348 → 232.354
31		Popout	LHS	232.356 → 232.358
32		Popout	LHS	232.360 → 232.362
33		Popout	LHS	232.389
34		Popout	LHS	232.393
35		Popout	LHS	232.396 → 232.397

#	Image	Defect	Side	Chainage span
36		Popout	LHS	232.405
37		Popout	LHS	232.411
38		Popout	LHS	232.414
39		Popout	LHS	232.416
40		Popout	LHS	232.421 → 232.422
41		Popout	LHS	232.425 → 232.426
42		Popout	LHS	232.430 → 232.431
43		Popout	LHS	232.435
44		Popout	LHS	232.437

#	Image	Defect	Side	Chainage span
45		Popout	LHS	232.443
46		Popout	LHS	232.446
47		Popout	LHS	232.514
48		Popout	LHS	232.521
49		Popout	LHS	232.533
50		Block Crack	LHS	232.536
51		Pothole	LHS	232.536
52		Popout	LHS	232.547 → 232.549
53		Popout	LHS	232.567

#	Image	Defect	Side	Chainage span
54		Popout	LHS	232.599
55		Popout	LHS	232.608
56		Popout	LHS	232.628
57		Popout	LHS	232.649
58		Popout	LHS	232.651
59		Popout	LHS	232.655 → 232.657
60		Popout	LHS	232.675
61		Popout	LHS	232.718
62		Popout	LHS	232.720

#	Image	Defect	Side	Chainage span
63		Popout	LHS	232.722
64		Popout	LHS	232.726
65		Popout	LHS	232.748
66		Popout	LHS	232.756
67		Popout	LHS	232.776
68		Popout	LHS	232.789 → 232.790
69		Popout	LHS	232.901
70		Popout	LHS	232.953
71		Popout	LHS	232.962
72		Pothole	RHS	232.082
73		Pothole	RHS	232.084
74		Pothole	RHS	232.336 → 232.337

#	Image	Defect	Side	Chainage span
75		Popout	RHS	232.460

Kilometer 233









8 major defects · LHS 3 · RHS 5

4 Pothole · 3 Popout · 1 Block Crack



Scan to open the km 233 inspection videos:

https://roadsdev.ibccube.ai/inspections/RI_20260223_Dive%20Ghat%20Hadapsar%20Saswad%20Highway?tab=videos&km;=233

#	Image	Defect	Side	Chainage span
1		Pothole	LHS	233.072
2		Pothole	LHS	233.150
3		Popout	LHS	233.150
4		Popout	RHS	233.142 → 233.143
5		Block Crack	RHS	233.143 → 233.150
6		Pothole	RHS	233.144
7		Popout	RHS	233.145 → 233.150
8		Pothole	RHS	233.147

Methodology

NHAIROMH-specific filter: this organisation has a customised major-defect set registered in categories.ORG_MAJOR_CATEGORIES. The default PMS set is intentionally narrower for this org.

Active categories: Block Crack (BLKCK), Pothole (POTHL), Pothole (large) (POTHLL), Pothole (medium) (POTHLM), Pothole (small) (POTHLS), Popout (PPOUT).

Listings are sorted by category, then km, then chainage, then side. Sample thumbnails are category-representative crops from the S3 inspection bucket; each listed row corresponds to a real detection emitted by the ML pipeline (see the data-lineage section of the summary report).

Generated 2026-05-27 07:50 UTC · IBCROADS (Stage 0 pipeline).